


Jacobs Taper Arbor



MAS 403 BT-SHANK

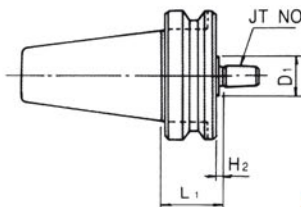



ORDER NO.	TAPER	JT.NO.	L1	D1	H2	WEIGHT (KG)	CODE NO.
BT-315		JT-6	45	30	4	1.2	3209-147
BT-316	BT40	JT-6	90	30	4	1.4	3209-148
BT-325	BT50	JT-6	45	30	4	4.2	3209-151
BT-332		B16	45	30	4	1.45	3209-155
BT-332-1	BT40	B18	45				3209-155A
BT-333		B16	45	30	4	5.1	3209-156
BT-333-1	BT50	B18	45				3209-156A

JACOBS TAPER ARBOR

Lever Checking Holders



M8 THREAD FOR CHECKING ARM

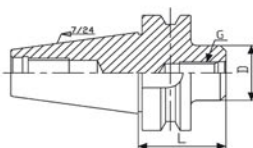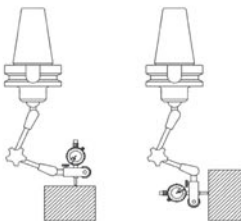

ORDER NO.	L	ØD	G	kgs	CODE NO.
BT40-M8	47	30	M8	1.3	3029-160
BT50-M8	58	30	M8		3029-161

Test Arbor



ORDER NO.	TAPER	G	A	L	KGS	CODE NO.
A50	BT-50	M24xP3.0	40		5.3	3405-412
A40	BT-40	M16xP2.0	40	250	3.9	3405-413
A30	BT-30	M12xP1.75	30		2.4	3405-414